

AIR OPERATED LOCKING DIFFERENTIAL

RD141

Toyota 8" IFS,34 SPL,58mm BRNG

**THIS MODEL WAS SUPERSEDED BY RD151, CROSSED OUT PARTS NOT AVAILABLE

| PARTS LIST | | | | |
|------------|-----|------------------------------------|--------------|-------|
| ITEM # | QTY | DESCRIPTION | PART# | NOTES |
| 01 | 1 | BONDED SEAL | 160703SP | |
| 02 | 1 | CLUTCH GEAR & WAVESPRING KIT | 050904SP | 4 |
| 03 | 1 | WAVESPRING | 150704SP | |
| 04 | 1 | LONG CROSS SHAFT | 060204SP | |
| 05 | 1 | SPIDER BLOCK | 070201SP | |
| 06 | 1 | DIFFERENTIAL CASE | 013022SP | |
| 07 | 1 | RETAINING PIN SET (PK OF 4) | 120601SP | |
| 08 | | TAPERED ROLLER BEARING | NOT SUPPLIED | |
| 09 | 1 | SHIM KIT | SHK009 | |
| * | 1 | MASTER SHIM | 150305 | |
| 10 | 1 | SEAL HOUSING KIT | 081812SP | |
| 11 | 1 | SEAL HOUSING O-RINGS (PK OF 2) | 160207-2 | 1 |
| 12 | 1 | FLANGE CAP KIT | 027322SP | |
| 13 | 1 | LOCKING SIDE GEAR | SEE NOTE | 2 |
| 14 | 4 | PINION THRUST WASHER | SEE NOTE | 3 |
| 15 | 4 | PINION GEAR | SEE NOTE | 2 |
| 16 | 2 | SHORT CROSS SHAFT | 060403SP | |
| 17 | 1 | SIDE GEAR | SEE NOTE | 2 |
| 18 | 2 | SIDE GEAR THRUST WASHER | SEE NOTE | 3 |
| 19 | 1 | COUNTERSUNK SCREW (PK OF 2) | 200213SP | |
| 20 | 2 | ANTI-FRICTION BUSHING (PTFE) | 160805SP | |
| * | 1 | BULKHEAD FITTING KIT (BANJO TYPE) | 170114 | 5 |
| * | 1 | NYLON AIR LINE (6mm DIA X 6m LONG) | 170314 | 5 |
| * | 1 | SOLENOID VALVE (12V) | 180103 | |
| * | 1 | SWITCH FR LOCKER | 180223 | |
| * | 1 | CABLE TIE (PK OF 25) | 180305 | |
| * | 1 | OPERATING & SERVICE MANUAL | 210200 | |
| * | 1 | INSTALLATION GUIDE | 2102141 | |
| | | | | |

NOTES

- 1 For replacement O-rings use only BS136 Viton 75.
- 2 Available only as complete 6 gear set #728H191
- 3 Available only as complete thrust washer kit #730H01
- 4 Always bench test both engagement and disengagement of the clutch gear before reinstalling *Air Locker* into the vehicle.
- 5 All diffs produced before serial #17070001 came with 5mm air connection system. For information contact ARB.
- Spare axle retaining clips may be required (not supplied) to refit CV shafts.
- For 8" IFS with 50mm carrier bearings refer to RD131 (Section 2.131).
- For 8" IFS with 53mm carrier bearings refer to RD111 (Section 2.111) or RD121 (Section 2.121).



^{*} Not illustrated in exploded view




AIR OPERATED LOCKING DIFFERENTIAL

RD141

Toyota 8" IFS,34 SPL,58mm BRNG

**THIS MODEL WAS SUPERSEDED BY RD151, CROSSED OUT PARTS NOT AVAILABLE

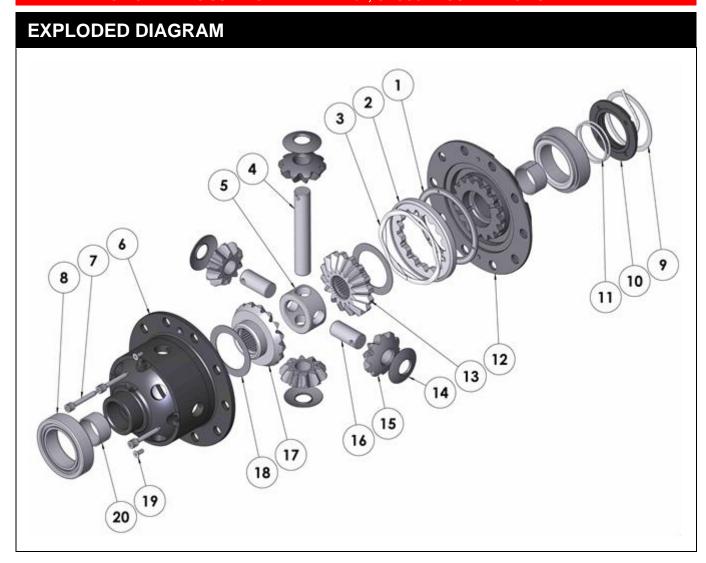

SPECIFICATIONS

Axle Spline 34 tooth, Ø34.9mm [1.37"]

Ratio Supported A

Ring Gear ID 134.0mm [5.28"] Ring Gear OD 200mm [8"]

Ring Gear Bolts 12 bolts on Ø160mm [6.30"]

Ring Gear Torque 135Nm [100 ft-lb]

Backlash 0.15-0.25mm [0.006-0.010"]